CINE – Setting shutter angles (other than 180°)

- Simultaneously press both menu buttons ◀ and ▶
- Use setting wheel to set desired angle

Photometry

- Select with the corresponding menu button ◀ ambient light ☀ or ▶ flash ⚡
- Set the diffuser ring at the meter head to desired measuring function
- Use setting menu button and setting wheel to select the corresponding measuring function
- Press the button **M** to measure

GOSSEN Foto- und Lichtmesstechnik GmbH
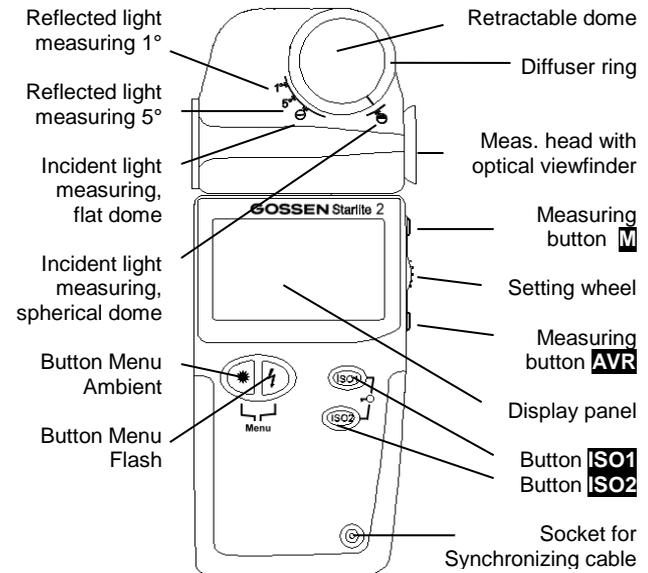Lina-Ammon-Str.22
D-90471 Nürnberg
Telefon: +49 911 8602-181
Telefax: +49 911-8602-142
Email: info@gossen-photo.de

GB

GOSSEN

Starlite 2
Condensed Instructions
15394 – 1/10.08

- Reflected light measuring 1°
- Reflected light measuring 5°
- Incident light measuring, flat dome
- Incident light measuring, spherical dome
- Button Menu Ambient
- Button Menu Flash
- Retractable dome
- Diffuser ring
- Meas. head with optical viewfinder
- Measuring button **M**
- Setting wheel
- Measuring button **AVR**
- Display panel
- Button **ISO1**
- Button **ISO2**
- Socket for Synchronizing cable

Function groups / measuring capabilities
selectable with DIP Switches in the battery compartment

Setting the film speeds
- Press an hold the ISO1 or ISO2 button
- Set the desired ISO value using the setting wheel, (e.g. 200)
- Corresponding values for ISO2 calculated based on the measuring results for ISO1

Measuring modes
- Select incident light or reflected light measurement with diffuser ring

Ambient light
- Press the left menu button ◀ to select ambient light ☀
- Press the left menu button ◀ and select with setting wheel desired function ⏲, **EV** or ⏱
- Release menu button
- Set desired f/stop or exposure time with setting wheel
- Press the button M to measure

Flash light
- Press the right menu button ▶ to select flash light ⚡
- Select sync speed with setting wheel
- Press the button M **to measure**
  Cord: flash will be automatically triggered
  Noncord: for 45s the meter is ready for manual triggering of the flash

Contrast measurements
- Keep M pressed and scan subject

Averaging
- Take first measurement with button M
- Take further measurements with AVR

CINE / Photometry
- Set switch **DIP1** in battery compartment to CINE

CINE
- Press the left menu button ◀ to select ambient light ☀
- Press the left menu button ◀ and use the setting wheel to select measuring unit f/s
- Release menu button
- Set desired f/s number with setting wheel
- Press the button M to measure